

US Army Corps of Engineers ® Los Angeles District



SAN DIMAS WASH 6 LEVEE SYSTEM LOS ANGELES COUNTY, CALIFORNIA NLD SYSTEM ID # 3805010067

PERIODIC INSPECTION REPORT NO 1 GENERALIZED EXECUTIVE SUMMARY

FINAL SYSTEM RATING: MINIMALLY ACCEPTABLE FINAL RATING DATE: FEBRUARY 27, 2015

PERIODIC INSPECTION REPORT PREPARED BY PRAAD/GENTERRA/TABER LLC. FOR THE U.S. ARMY CORPS OF ENGINEERS, LOS ANGELES DISTRICT

> SUBMITTED: DECEMBER 2014 INSPECTED: MAY 6, 2014

EXECUTIVE SUMMARY

This Executive Summary provides an introduction to the San Dimas Wash 6 Levee System (SDW6) Periodic Inspection Report No. 1, an overview of the system, a summary of the major findings of the periodic inspection, and the overall rating for the system.

1.1 Scope and Purpose of Periodic Inspections

The purpose of the SDW6 system periodic inspection is to identify deficiencies that pose hazards to human life or property. The inspection is intended to identify the issues in order to facilitate future studies and associated repairs, as appropriate.

This current assessment of the general condition of the levee system is based on available data and visual inspections. Detailed investigation and analysis involving hydrologic design, topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of this levee system inspection.

1.2 System Summary

SDW6 is located in the city of San Dimas, in Los Angeles County, in the State of California. SDW6 is located along the left (south) bank of the San Dimas Wash, from STA. 409+25 (downstream side of San Dimas Canyon Road bridge) to STA. 369+77.49 (downstream side of San Dimas Avenue bridge), with a total length of 0.79 miles (per the National Levee Database (NLD)). Figure 1.1 shows the SDW6 extents and leveed area per the NLD.

SDW6 includes an unlined channel with trapezoidal levee (upstream portion), a rectangular lined channel with reinforced concrete walls and invert (downstream portion), and a reinforced concrete box (RCB) culvert under Foothill Boulevard. SDW6 includes side drainage structures (see Parts 3.1 and 3.1.2).

Based on field observations, the levee is 0 feet in height (landside levee toe to levee crown) from approximate STA. 388+30 to STA. 369+77.49, which is the recommended channel reach (see Figures 1.1 and 1.2). As a result, the length of the levee is recommended to change from 0.79 miles (per NLD) to 0.42 miles (per field observation), from approximate STA. 409+25 to STA. 388+30 (see Part 6). The levee reach is relevant to the Periodic Inspection of the levee system. However, the channel reach was separated from the levee reach to retain the channel reach information that was obtained during the field inspection of the levee system.

The SDW6 improvements were federally authorized by the Flood Control Act of 1941 and were federally constructed in 1962.

SDW6 consists of one segment and is operated by the Los Angeles County Department of Public Works (LACDPW).

SDW6 is identified in the NLD as System ID No. 3805010067.

1.3 Summary of Major Deficiencies Found and Subsequent Repairs

SDW6 was inspected on May 6, 2014. The local sponsor (LACDPW) and USACE representatives were present for the periodic inspection. During the periodic inspection of the system, several deficiencies were noted for which remedial actions are required. Each item of concern observed during the site inspection was rated Unacceptable, Minimally Acceptable, or Acceptable. The following major deficiencies (Unacceptable items) were noted during the periodic inspection of the periodic inspection of the project features:


• Large trees, tree stumps, and significant vegetative growth on the landside and/or riverside of the levee, within and just beyond apparent right-of-way limits but within the vegetation free zone.

1.4 Overall Rating

The Levee Safety Out-Brief Meeting was held on August 6, 2014. An engineering determination as to the overall levee rating was made for this levee system. The San Dimas Wash 6 Levee System is rated as "Minimally Acceptable."

A "Minimally Acceptable" system rating is where one or more items are rated as Minimally Acceptable or one or more items are rated as Unacceptable and an engineering determination concludes that the Unacceptable items would not prevent the segment/system from performing as intended during the next significant runoff event.

The local sponsor will be notified of the overall rating of the levee system by letter with instructions to correct the Unacceptable rated items immediately and to correct the Minimally Acceptable rated items within two years so that they do not deteriorate further and become Unacceptable.

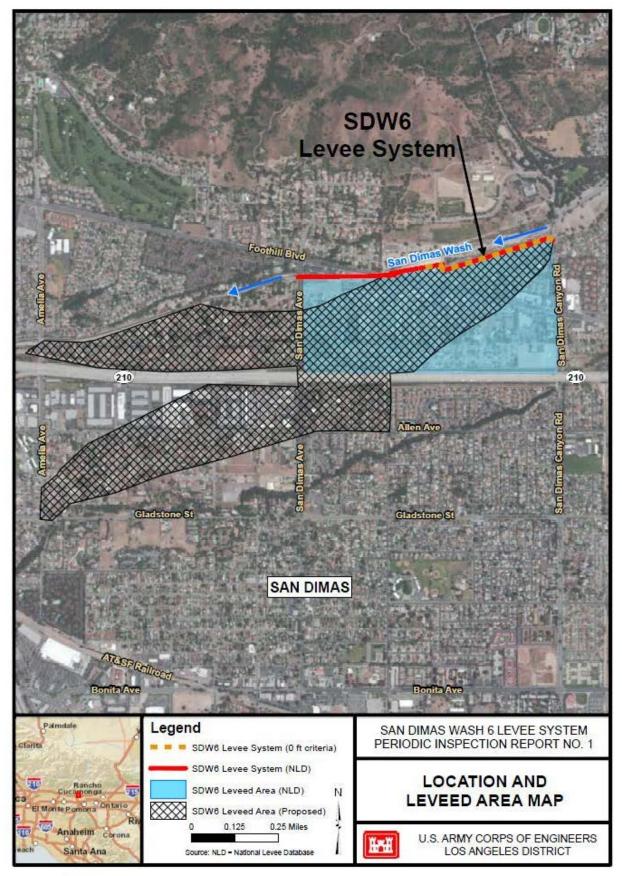

SAN DIMAS WASH 6 LEVEE SYSTEM FINAL PERIODIC INSPECTION REPORT NO. 1

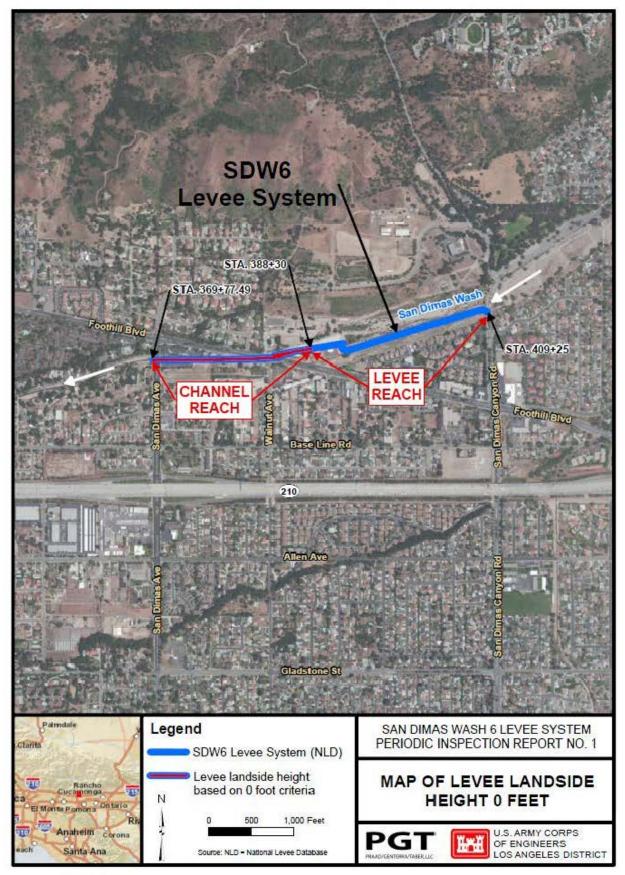


Figure 1.2